

DSP_NOT_RUNNING	1
ESI_FILE_NOT_FOUND	1
EEPROM_READ_FAILED	1
REVISIONNO_NOT_MATCH	1
SLOT_SCAN_FAILED	3
ALIAS_DUPLICATED	3
REVERSE_CONNECTED_SLAVE	3
ALSTATE_NOT_INIT	4

Scan Error

× Configuration

SCAN

Error

.

DSP_NOT_RUNNING

- Master DSP(Fimrware)가 .
- PC .
- 12V .

ESI_FILE_NOT_FOUND


- ESI File(.xml) .
- ESI ¹⁾ .\ComilDE\Data\Xml , Configurator .

EEPROM_READ_FAILED

- EEPROM VendorID, ProductCode, RevisionNO
◦ ESI File(.xml)
- SCAN .

REVISIONNO_NOT_MATCH

- ESI File(.xml) RevisionNo 가 .
◦ ESI 가 ²⁾ .

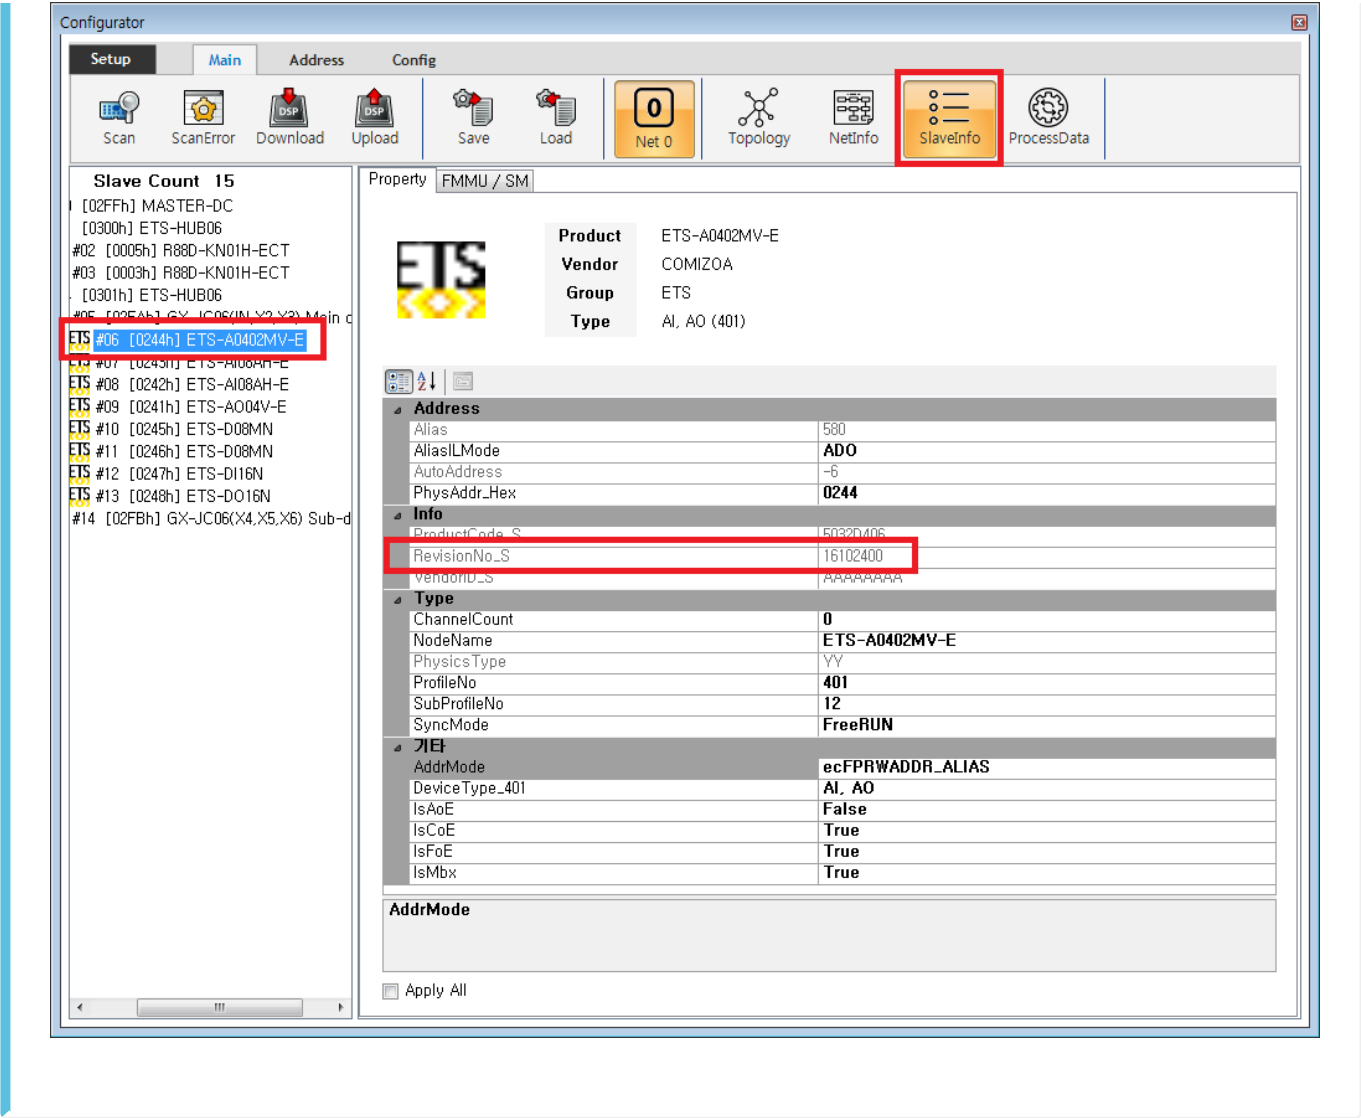

- RevisionNo **SlaveInfo** Tab RevisionNo .



- ESI "RevisionNo" Device Type Node 가 .
- RevisionNo가 Device 가 ESI 3) '.\ComiIDE\Data\Xml' , Configurator .


SLOT_SCAN_FAILED

- MDP Profile가
 ProcessData가, Master
 Download, PDO Data가 OP Status
- SlotInfo Slot가 Setup Read 0xF050

ALIAS_DUPLICATED

- 가가
- DeviceID Switch Address Address read failed

REVERSE_CONNECTED_SLAVE

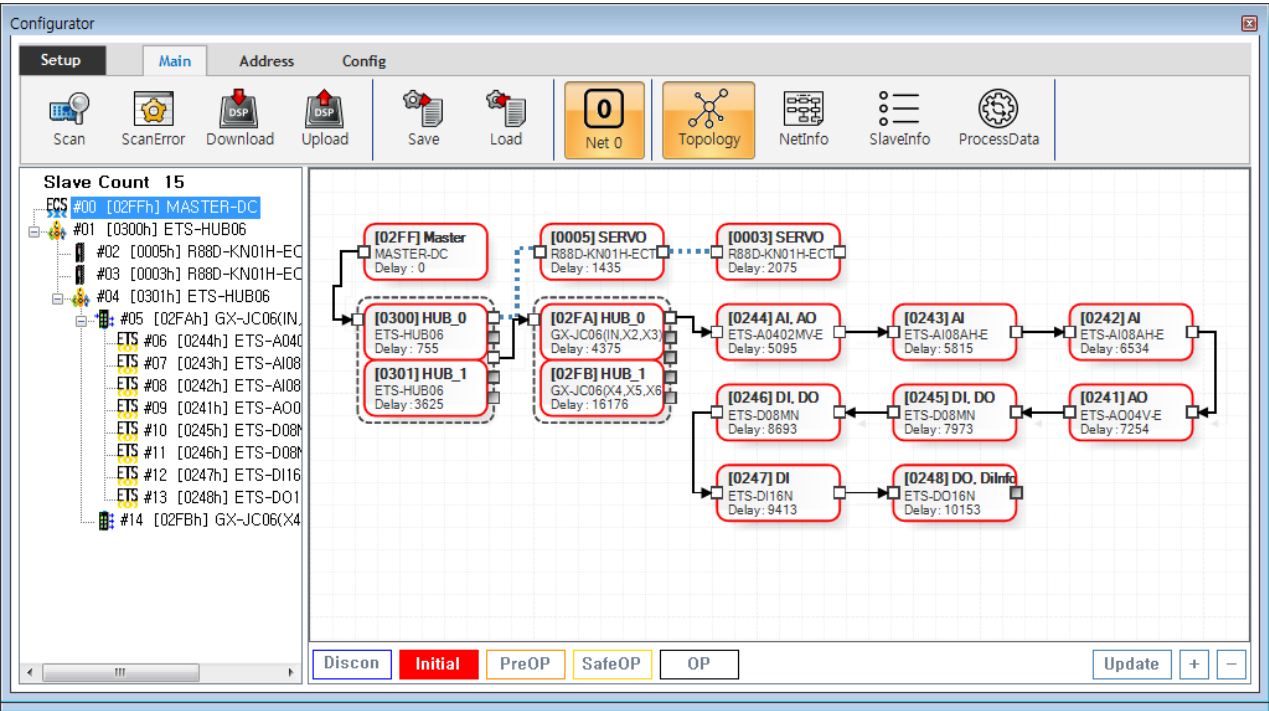

- InPort OutPort 가 .
 - TopologyView .
- In/Out Port .
 - Port 가 , / Port가 InPort .

ALSTATE_NOT_INIT

- AI Status 가 Initial
 - AI Status 가 Initial , EEPROM Read Failed
- , Scan .

- 1)
- 2)
- 3) SW(Firmware) RevisionNo

From:
<http://comizoa.co.kr/info/> - -

Permanent link:
http://comizoa.co.kr/info/doku.php?id=platform:ethercat:1_setup:10_config:ts:10_scan_error&rev=1586855284

Last update: 2024/07/08 18:22