

Scan Error	1
DSP_NOT_RUNNING	1
ESI_FILE_NOT_FOUND	1
EEPROM_READ_FAILED	1
REVISIONNO_NOT_MATCH	1
SLOT_SCAN_FAILED	3
ALIAS_DUPLICATED	3
REVERSE_CONNECTED_SLAVE	3
ALSTATE_NOT_INIT	3

Scan Error

x Configuration

SCAN

Error

.

DSP_NOT_RUNNING

- Master DSP(Fimrware)가
- PC
- 12V

ESI_FILE_NOT_FOUND

- ESI File(.xml)
- ESI 1) .\ComilDE\Data\Xml , Configurator

EEPROM_READ_FAILED

- EEPROM VendorID, ProductCode, RevisionNO
 - ESI File(.xml)
- EEPROM Read Failed
 - Master AIStatus Initial
 - Initial Slave
 - Slave AIStatus가 Initial , SCAN

REVISIONNO_NOT_MATCH

- ESI File(.xml) RevisionNo 가 2)
 - ESI 가

Configurator

Setup

Main

Address

Config

Scan

ScanError

Download

Upload

Save

Load

Net 0

Topology

NetInfo

SlaveInfo

ProcessData

Slave Count 15

[02FFh] MASTER-DC

[0300h] ETS-HUB06

#02 [0005h] R88D-KN01H-ECT

#03 [0003h] R88D-KN01H-ECT

[0301h] ETS-HUB06

#05 [02FAh] GX-JC06(X4,X5,X6) Sub-d

ETS #06 [0244h] ETS-A0402MV-E

#07 [0243h] ETS-A08AH-E

ETS #08 [0242h] ETS-A08AH-E

ETS #09 [0241h] ETS-A04V-E

ETS #10 [0245h] ETS-D08MN

ETS #11 [0246h] ETS-D08MN

ETS #12 [0247h] ETS-DI16N

ETS #13 [0248h] ETS-DI16N

#14 [02FBh] GX-JC06(X4,X5,X6) Sub-d

Property FMMU / SM



Product

Vendor

Group

Type

ETS-A0402MV-E

COMIZOA

ETS

AI, AO (401)

Address

Info

Type

기타

Alias

AliasILMode

AutoAddress

PhysAddr_Hex

580

ADO

-6

0244

ProductCode_S

RevisionNo_S

VendorID_S

5032D406

16102400

AAAAAAAA

ChannelCount

NodeName

PhysicsType

ProfileNo

SubProfileNo

SyncMode

0

ETS-A0402MV-E

YY

401

12

FreeRUN

AddrMode

DeviceType_401

IsAoE

IsCoE

IsFoE

IsMbx

ecFPRWADDR_ALIAS

AI, AO

False

True

True

True

AddrMode

Apply All

• RevisionNo **SlaveInfo** Tab RevisionNo

17286

>>>

</Eeprom>

17287

>>>

</Device>

17288

>>>

<Device Physics="YY">

17289

>>>

<Type ProductCode="#x5032D406" **RevisionNo="#x16102400"** ETS-A0402MV-E</Type>

17290

>>>

<Name LcId="1033"><![CDATA[ETS-A0402MV-E 6CH Analog Current/Voltage Input, Voltage Output]]></Name>

17291

>>>

<URL LcId="1033"><![CDATA[http://www.comizoa.com]]></URL>

17292

>>>

<Info>

17293

>>>

<Electrical>

17294

>>>

<EBusCurrent>120</EBusCurrent>

17295

>>>

</Electrical>

17296

>>>

<Mailbox>

17297

>>>

<Timeout>

17298

>>>

<RequestTimeout>100</RequestTimeout>

17299

>>>

<ResponseTimeout>2000</ResponseTimeout>

17300

>>>

</Timeout>

17301

>>>

</Mailbox>

17302

>>>

<IdentificationReg134>1</IdentificationReg134>

- ESI "RevisionNo" Device Type Node 가
- RevisionNo가 Device 가 ESI 3) '.\ComilDE\Data\Xml' , Configurator


SLOT_SCAN_FAILED

- MDP Profile 가 , Master , PDO Data가 OP Status
- SlotInfo Slot 가 Setup Read 0xF050

ALIAS_DUPLICATED

- 가 가
- DeviceID Switch Address Address read failed

REVERSE_CONNECTED_SLAVE

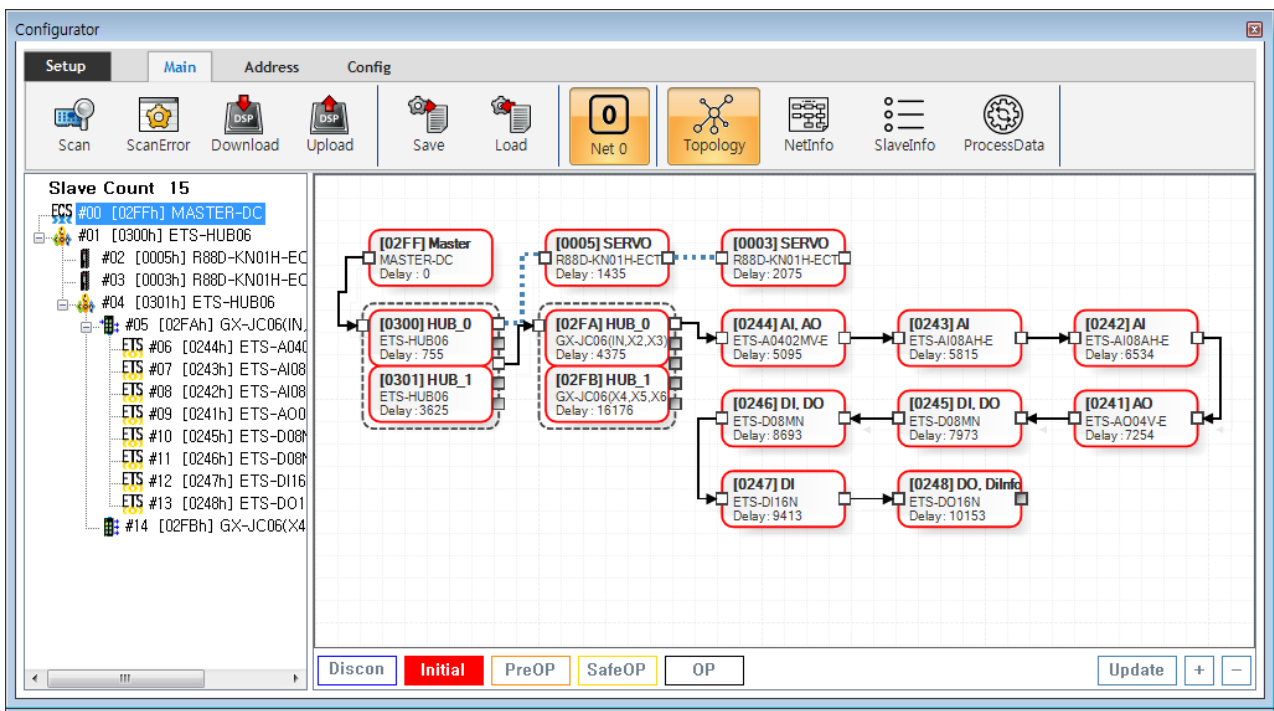

- InPort OutPort 가 TopologyView
- In/Out Port Port 가 , / Port가 InPort

ALSTATE_NOT_INIT

- AI Status 가 Initial
 - AI Status 가 Initial , EEPROM Read Failed
 - , Scan .

1)

2)

3)

SW(Firmware) RevisionNo

From:
<http://comizoa.co.kr/info/> - -

Permanent link:
http://comizoa.co.kr/info/platform:ethercat:1_setup:10_config:ts:10_scan_error

Last update: **2020/12/04 17:17**